



MAPAL Turning inserts with PCBN

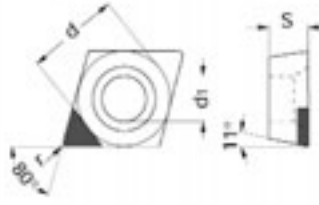

CPMW...

Description	Dimensions (mm)				PCBN													
					FJC1A0		FJE1A0		FJF1A0		FJG1A0		FJJ1A0		FJK1A0		FJL1A0	
	d	s	r	d1	Cutting edges		Cutting edges		Cutting edges		Cutting edges		Cutting edges		Cutting edges			
				F01	T35	F01	T42	F01	T43	F01	T35	F01	T48	F01	T43	F01	T43	
CPMW 04T102 ...N-OAA	4,76	1,98	0,2	2,1	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 04T104 ...N-OAA	4,76	1,98	0,4	2,1	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 05T102 ...N-OAA	5,56	1,98	0,2	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 05T104 ...N-OAA	5,56	1,98	0,4	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 050202 ...N-OAA	5,56	2,38	0,2	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 050204 ...N-OAA	5,56	2,38	0,4	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 060202 ...N-OAA	6,35	2,38	0,2	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 060204 ...N-OAA	6,35	2,38	0,4	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 060208 ...N-OAA	6,35	2,38	0,8	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 09T302 ...N-OAA	9,52	3,97	0,2	4,4	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 09T304 ...N-OAA	9,52	3,97	0,4	4,4	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 09T308 ...N-OAA	9,52	3,97	0,8	4,4	o	o	o	o	o	o	o	o	o	o	o	o	o	o

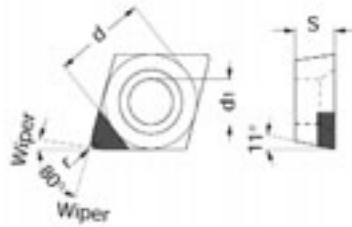

CPMW...

Wiper


Description	Dimensions (mm)				PCBN													
					FJD1A0		FJH1A0		FJM1A0									
	d	s	r	d1	Cutting edges		Cutting edges		Cutting edges									
				W01	W48	W01	W48	W01	W62									
CPMW 05T102 ...N-OAA	5,56	1,98	0,2	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 05T104 ...N-OAA	5,56	1,98	0,4	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 050202 ...N-OAA	5,56	2,38	0,2	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 050204 ...N-OAA	5,56	2,38	0,4	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 060202 ...N-OAA	6,35	2,38	0,2	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o
CPMW 060204 ...N-OAA	6,35	2,38	0,4	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o

MAPAL Turning inserts with PCBN



CPMW...

Description	Dimensions (mm)				PCBN																			
					FJC1A0		FJE1A0		FJF1A0		FJG1A0		FJJ1A0		FJK1A0		FJL1A0							
					Cutting edges		Cutting edges		Cutting edges		Cutting edges		Cutting edges		Cutting edges		Cutting edges							
d	s	r	d1	F01	T35	F01	T42	F01	T43	F01	T35	F01	T48	F01	T43	F01	T43							
CPMW 050204 ...N-OAAX	5,56	2,38	0,4	2,5	o	o	o	o	o	o	o	o	o	o	o	o	o	o						
CPMW 060204 ...N-OAAX	6,35	2,38	0,4	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o						
CPMW 060208 ...N-OAAX	6,35	2,38	0,8	2,8	o	o	o	o	o	o	o	o	o	o	o	o	o	o						

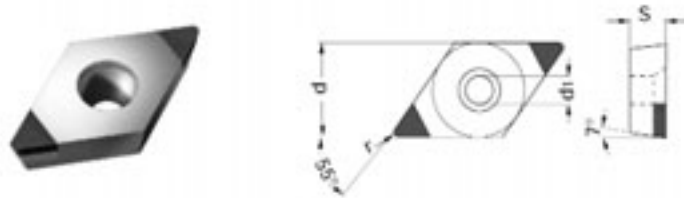

DCGW...

Description	Dimensions (mm)				PCBN																			
					FDG1A0						FDC1A0						FDA1A0							
					Cutting edges						Cutting edges						Cutting edges							
d	s	r	d1	T51	S52	S54	S55	S58	S60	T51	S52	S54	S55	S58	S60	T51	S52	S54	S55	S58	S60			
DCGW 070202 ...N-OAB	6,35	2,38	0,2	2,8			o																	
DCGW 070204 ...N-OAB	6,35	2,38	0,4	2,8			o	o	o		o													
DCGW 070208 ...N-OAB	6,35	2,38	0,8	2,8			o	o																
DCGW 11T302 ...N-OAB	9,535	3,97	0,2	4,4			o		o															
DCGW 11T304 ...N-OAB	9,535	3,97	0,4	4,4			o	o	o		o			o		o			o					
DCGW 11T308 ...N-OAB	9,535	3,97	0,8	4,4			o	o		o	o					o								
DCGW 11T312 ...N-OAB	9,535	3,97	1,2	4,4			o																	

Order example:

Please state the reference with the cutting edge and PCBN grade selected in your order.

DCGW 11T304 S55 N-OAB-FDA1A0